



MODEL
XF

DATE
04 JUNE 2009

NUMBER
JTB00159
(Issue 1)

Service

TECHNICAL BULLETIN

SECTION: 501

Roof Console Lights that do not Operate as Expected - Repair Procedure

AFFECTED VEHICLE RANGE:

XF (X250)

VIN: R00001 - R49197
Model Year: 2009 - 2010

CONDITION SUMMARY:

Situation: The roof / overhead console lights may not operate as expected. This may be caused by oxidization of the electrical contacts within the roof console.

Action: In the event of a customer concern of the above, refer to the Repair Procedure outlined below to clean and grease the roof console lamp electrical contacts.

PARTS:

C2C 33548Wipe cleaner Qty: 1
JLM 21802Grease syringe Qty: 1

TOOLS:

Refer to Workshop Manual (GTR) for any required special tools

WARRANTY:

△ NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

<i>Description</i>	<i>SRO</i>	<i>Time (hours)</i>	<i>Condition Code</i>	<i>Causal Part</i>
Roof console repair	76.95.55	0.30	X2	C2Z 5144AMN

Normal warranty policy and procedures apply.

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Dealer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

REPAIR PROCEDURE

CLEAN / GREASE ROOF CONSOLE LAMP CONTACTS



NOTE: Global Technical Reference (GTR) lookup sequence is as follows:
GTR Home > NAS > X250-XF > Service Information > Model Year > Workshop Manuals >
5: Body and Paint > 501-12: Instrument Panel and Console

1. Refer to Workshop Manual (GTR) section 501-12: Instrument Panel and Console and remove the roof / overhead console.
2. Release connection for microphone.
3. Remove the retaining cover. (Figure 1)
 - Release the six clips.



CAUTION: take care to not damage electrical harness.

4. Disconnect the printed circuit board. (Figure 2)

Figure 1



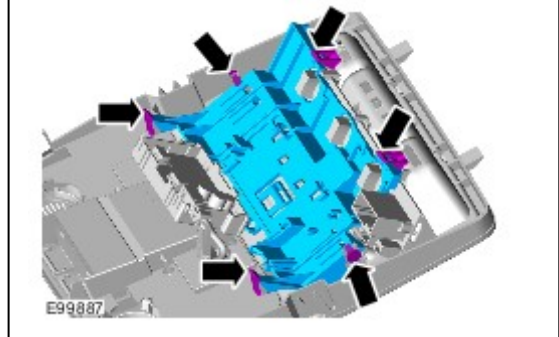


Figure 2

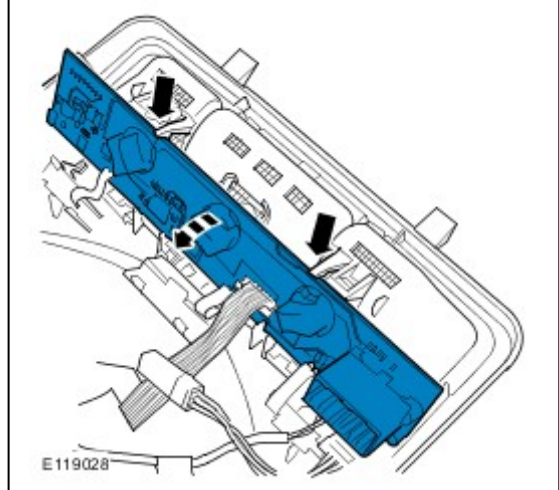

5. Using the wipe cleaner (C2C 33548), clean the six electrical contacts. (Figure 3)

Figure 3

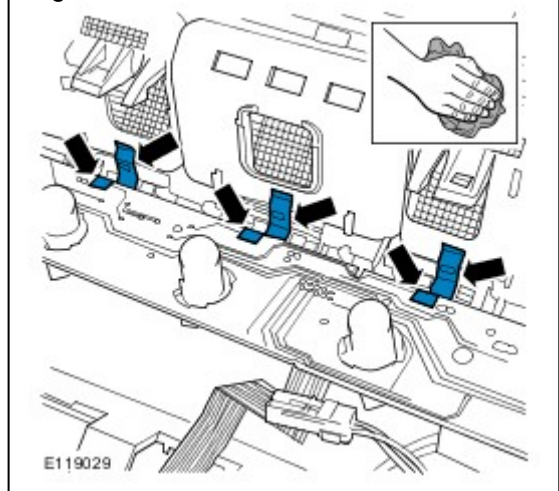

6. Using the grease syringe (JLM 21802), apply 2-3mm of grease to each electrical contact. (Figure 4)
7. Connect the printed circuit board.
8. Install the retaining cover.
9. Connect the microphone.
10. Refer to Workshop Manual (GTR) section 501-12: Instrument Panel and Console and install the roof / overhead console.

